
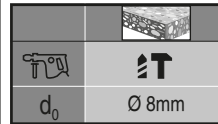
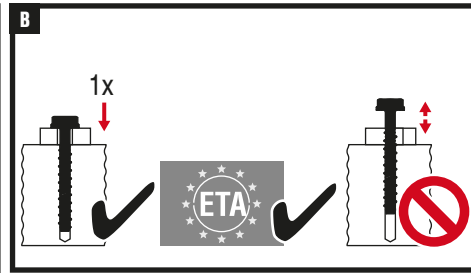


$h_{nom}=70\text{mm}$ $t_{fix2}=0...10\text{mm}$		
HUS3-H 8	t_{fix1}	$t_{fix1}+t_{fix2}$
8x75	5 mm	5...15 mm
8x85	15 mm	15...25 mm
8x100	30 mm	30...40 mm
8x120	50 mm	50...60 mm
8x150	80 mm	80...90 mm

h_{nom}	h_1
60	70
70	80




h_{nom}	$h_{1,nc}$	$h_{1,nc}$
60	94	70
70	104	80

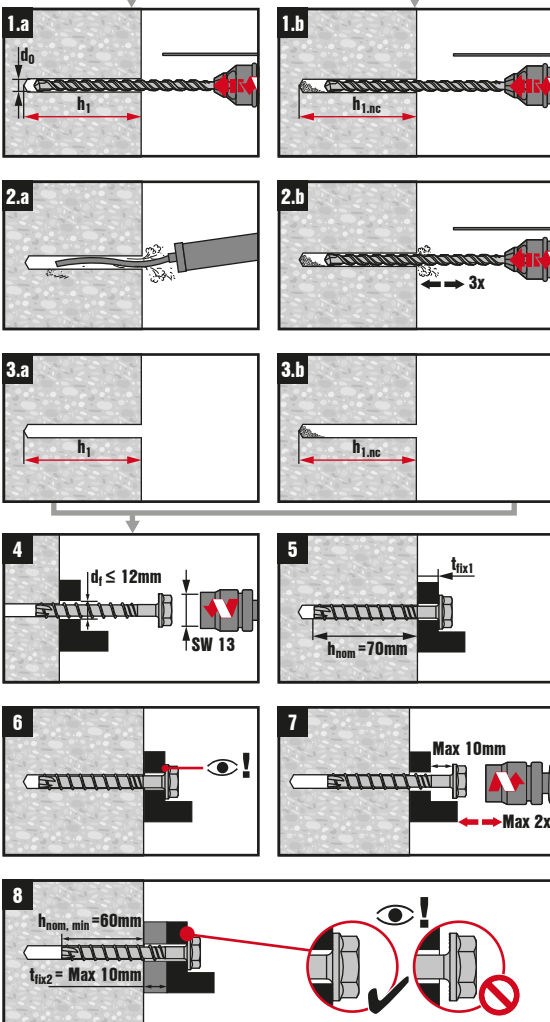


$h_{nom1}=50\text{mm}$ $h_{nom2}=60\text{mm}$ $h_{nom3}=70\text{mm}$			
HUS3-H 8	t_{fix1}	t_{fix2}	t_{fix3}
8x55	5 mm	-	-
8x65	15 mm	5 mm	-
8x75	25 mm	15 mm	5 mm
8x85	35 mm	25 mm	15 mm
8x100	50 mm	40 mm	30 mm
8x120	70 mm	60 mm	50 mm
8x150	100 mm	90 mm	80 mm


h_{nom}	h_1
50	60
60	70
70	80

h_{nom}	$h_{1,nc}$	$h_{1,nc}$
50	84	60
60	94	70
70	104	80














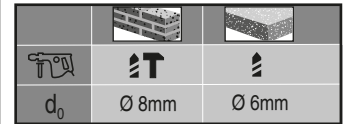
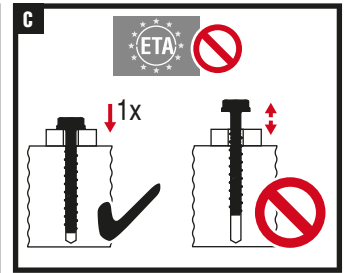
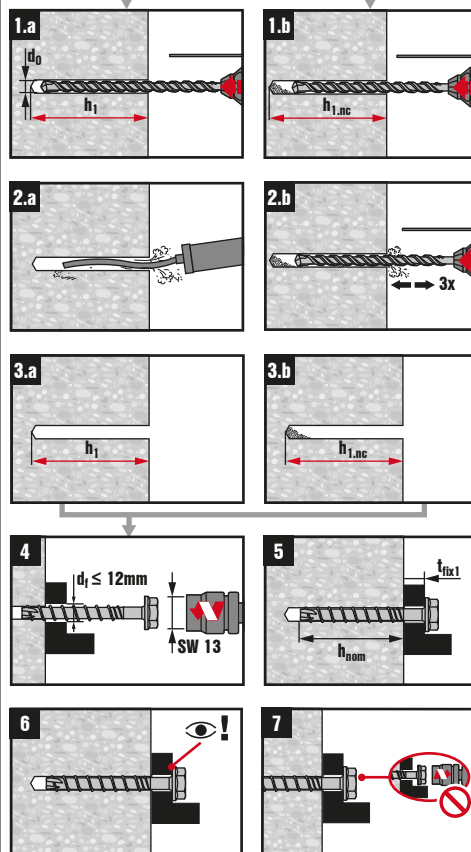


$h_{nom2}=60\text{mm}$	
HUS3-H 8	t_{fix2}
8x55	-
8x65	5 mm
8x75	15 mm
8x85	25 mm
8x100	40 mm
8x120	60 mm
8x150	90 mm

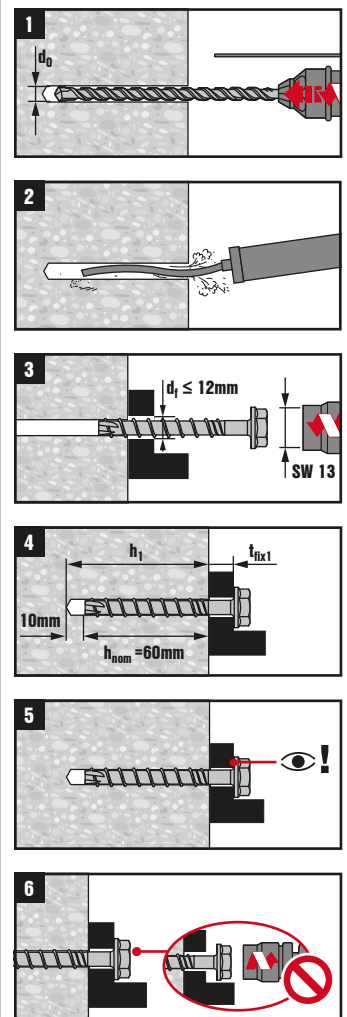

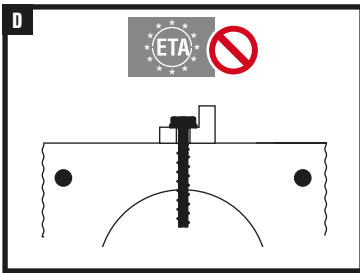

min. t_{fix} = 5mm	
HUS3-H 8	t_{fix}
8x55	5 mm
8x65	5 mm
8x75	5 mm
8x85	15 mm
8x100	30 mm
8x120	50 mm
8x150	80 mm

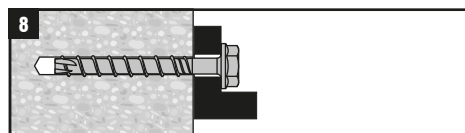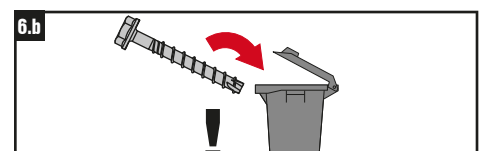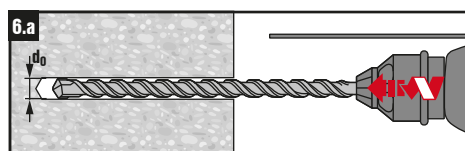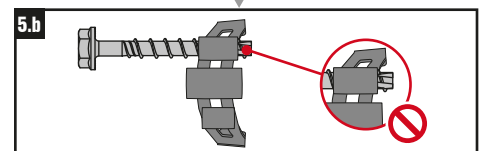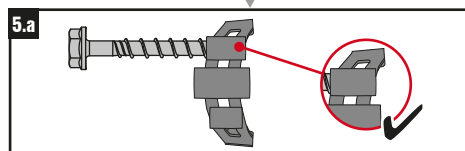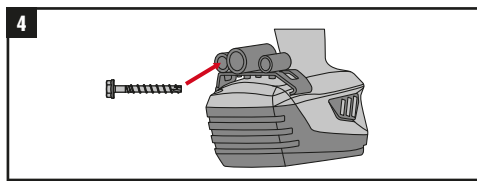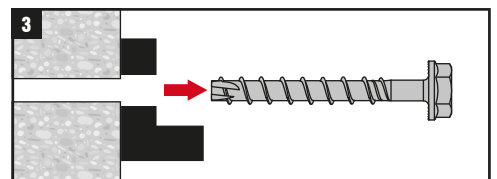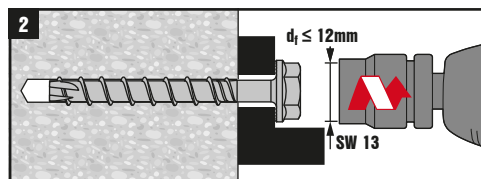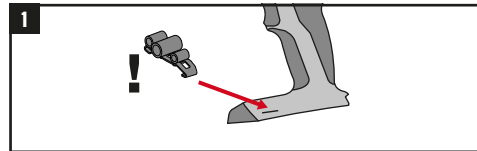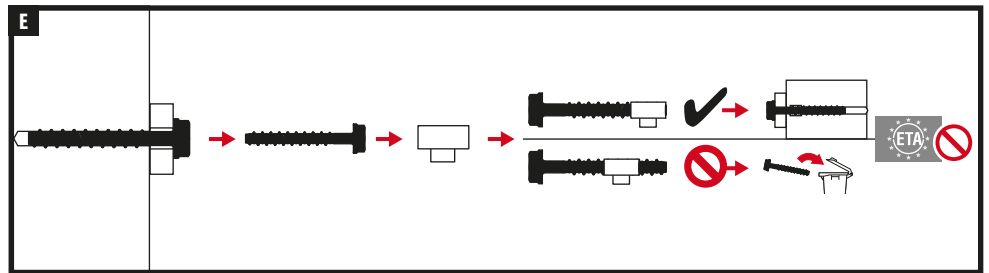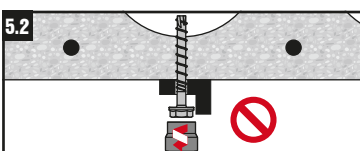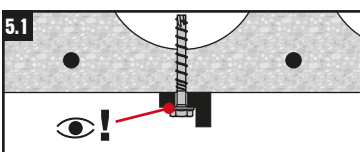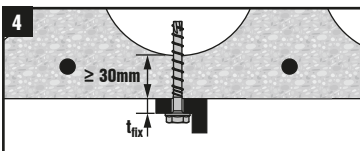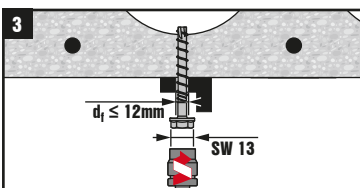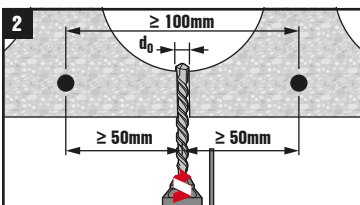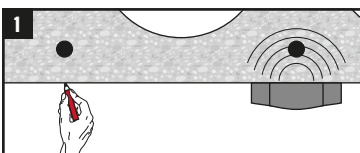

HUS3-H 8	$h_{nom1}=50mm$	$h_{nom2}=60mm$	$h_{nom2}=70mm$
	t_{fix1}	t_{fix2}	t_{fix3}
8x55	5 mm	-	-
8x65	15 mm	5 mm	-
8x75	25 mm	15 mm	5 mm
8x85	35 mm	25 mm	15 mm
8x100	50 mm	40 mm	30 mm
8x120	70 mm	60 mm	50 mm
8x150	100 mm	90 mm	80 mm

HUS3-H 8	SIW 22-A 1/2" (01)	SIW 6AT-A22 1/2" (01)	SIW 22T-A 1/2" (01)	SIW 22T-A 3/4" (01)	SIW 9-A22 3/4" (01)
	✓	✓	✓	✓	✗